



Jones Swenson Auctions (Robert Huey)
1202 Lakeway Drive, Austin, TX 78734
(512) 809-0640

VIN: 1XPXD49X6JD480595

2018 PETERBILT 389

SPECIFICATIONS	
MILEAGE	497,903 / 497,904 (ECM)
ENGINE HOURS	33,734
ENGINE	CUMMINS X15 14.9L 565 HP
ENG BRAKE	YES
FUEL / TANKS	DIESEL - 2 ALUM 215 GAL TOTAL
EXHAUST	DUAL
EXTERNAL BREATHERS	DUAL
TRANSMISSION	EATON-FULLER RTLO18918A 18 SPD MANUAL
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
WET LINE	YES
REAR END	MERITOR 2.64
AXLE TYPE	TANDEM - F 12,000 LB / R 40,000 LB
GVWR	52,000
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	272"
TIRE SIZE	11R 24.5
WHEELS	F ALUMINUM / R ALUMINUM
WHEEL 5TH	AIR SLIDE
AIR COND	YES, OPERATIONAL
SLEEPER	70"
INTERIOR COLOR	BLACK
RADIO	AM/FM, NOT OPERATIONAL
MIRRORS	DUAL POWER
HIGH BACK SEATS	DUAL
PASSENGER SEAT	AIR RIDE
EXTERIOR COLOR	BLACK
BUMPER	CHROME
EXTERIOR OPTS	HEATED MIRRORS, PARTIAL FAIRINGS



BRAKES	
LEFT FRONT	RIGHT FRONT
DISC	DISC
LEFT REAR 1	RIGHT REAR 1
DISC	DISC
LEFT REAR 2	RIGHT REAR 2
DISC	DISC

TIRES & WHEELS			
LEFT FRONT		RIGHT FRONT	
17 / 32 GENERAL ALUMINUM		16 / 32 GENERAL ALUMINUM	
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1
21 / 32 MICHELIN ALUMINUM	21 / 32 MICHELIN ALUMINUM	7 / 32 MICHELIN ALUMINUM	8 / 32 MICHELIN ALUMINUM
LEFT OUTER 2	LEFT INNER 2	RIGHT INNER 2	RIGHT OUTER 2
25 / 32 GENERAL ALUMINUM	25 / 32 GENERAL ALUMINUM	7 / 32 MICHELIN ALUMINUM	7 / 32 MICHELIN ALUMINUM
FRONT TIRES: 11R 24.5		REAR TIRES: 11R 24.5	

GENERAL OBSERVATIONS

OIL MILKY?	NO	LIGHTS WORK?	YES - ALL
OIL LEAKS?	YES	WIPERS WORK?	YES
WATER LEAKS?	NO	GAUGES WORK?	YES - ALL
OIL IN COOLANT?	NO	AIR HORN WORKS?	YES
CLUTCH PLAY?	OK	CITY HORN WORKS?	YES
STARTS?	YES		

DRIVES	YES	DIESEL PARTICULATE FILTER	PASS
--------	-----	---------------------------	------


ADDITIONAL OBSERVATIONS

ENGINE FRONT AND REAR MAIN SEAL ARE LEAKING

WEAR & TEAR DETAIL	
DIAGNOSTICS	1 ACTIVE / 3 INACTIVE FAULTS DETECTED - (SEE ECM REPORT)
STEERING WHEEL	SURFACES HAVE WEAR
SEATS	P/S WORN AND HAS STAINS. D/S HAS HOLES AND STAINED
WINDSHIELD	CHIPPED RIGHT SIDE
RADIO	NOT WORKING
BUMPER	BENT ON D/S CORNER
REFRIGERATOR	FOOD/DEBRIS STAINING
TIRES	4 ARE LESS THAN 10/32

REPORT PHOTOS



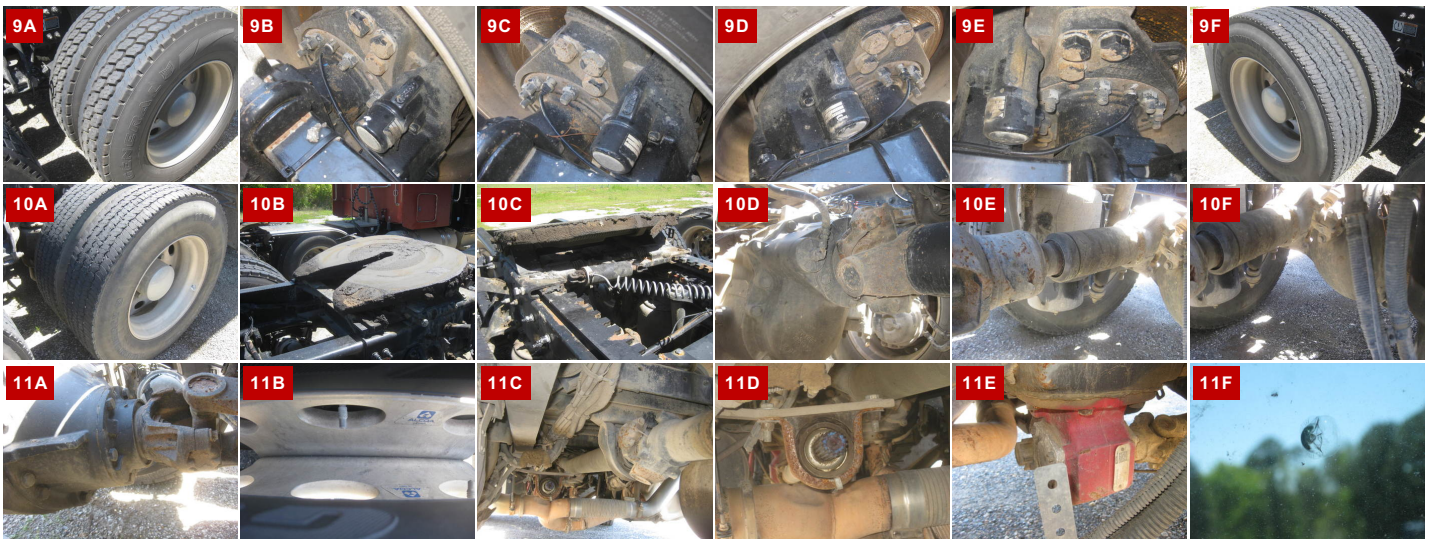

REPORT DOCUMENTS

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services
101 W. Shrader St. Liberty, MO 64068
www.nationalinspect.com

DIAGNOSTIC REPORT

VIN: 1XPXD49X6JD480595

Model Year: 2018

Manufacturer: Peterbilt

COMPONENT FAULT CODES 4 TOTAL / 1 ACTIVE / 3 INACTIVE

ENGINE #1 - J1939 ACTIVE FAULT CODES (1)

Vehicle Make: Cummins	Fault Description: Water In Fuel Indicator	SPN 97
ECM Serial Number: 79994531	FMI Description: Voltage above Normal, or Shorted to High Source	FMI: 3
ECM Model: 6X3u17D1500000000	Count: 1	

INACTIVE FAULT CODES (3)

Fault Description: ECL	SPN 111
FMI Description: Data Valid but below Normal Operating Range - Moderately Severe Level	FMI: 18
Count: 15	

Fault Description: Engine Injector Metering Rail 1 Pressure	SPN 157
FMI Description: Data Valid but below Normal Operating Range - Moderately Severe Level	FMI: 18
Count: 0	

Fault Description: ECU Power Output Supply Voltage #1	SPN 3597
FMI Description: Data Erratic, Intermittent or Incorrect	FMI: 2
Count: 2	

RETARDER - ENGINE - J1939 ACTIVE FAULT CODES (0)

ECM Serial Number:	None
ECM Model:	

INACTIVE FAULT CODES (0)

None

PARAMETERS

ENGINE #1 - J1939

Rated Horsepower	565 BHP	Engine Rated RPM	Not Available
MIL Status	Off	Fuel Level	0 %
Battery Voltage	13.95 V	Ignition Voltage	Not Available
Engine RPM	707 RPM	Vehicle Speed	0 mph
Throttle Position	0 %	Brake Switch	Released
Clutch Switch	Released	Engine Operating State	Engine Stopped
Engine Intake Air Temperature	Not Available	Engine Intake Air Pressure	Not Available
Barometric Pressure	14.43 psi	Coolant Level	100 %
Coolant Temperature	120.2 °F	Oil Level	Not Available
Oil Temperature	120.1 °F	Oil Pressure	38.3 psi
DPF Status	Regen not Needed	Regen Status	N/A
DPF Active Regen Inhibited Status	Inhibited	DPF Active Regen Inhibited Due to Inhibit Switch	Not Inhibited
DPF Regen Inhibit Switch	N/A	DPF Regen Force Switch	N/A

DIAGNOSTIC REPORT

VIN: 1XPXD49X6JD480595

Model Year: 2018

Manufacturer: Peterbilt

ENGINE #1 - J1939

Exhaust Temperature 1	Error	Exhaust Temperature 2	Not Available
Exhaust Temperature 3	Not Available	DPF Intake Temperature	Error
DPF Outlet Temperature	Not Available	DPF Differential Pressure	0 psi

LIFE DATA

ENGINE #1 - J1939

Distance	497904.65 mi	Hours	33734.40 hr
Fuel Used	122419.1 gal	Average Fuel Economy	N/A
Engine Idle Hours	20947.45 hr	Engine Idle Fuel Used	17457.8 gal
PTO Hours	3317.80 hr	PTO Fuel Used	8753.2 gal
DPF Number of Inhibited Active Regen	Not Available	DPF Number of Manual Active Regen	Not Available
DPF Fuel Used	0.0 gal		

TRIP DATA

ENGINE #1 - J1939

Distance	497905.17 mi	Fuel Used	122419.0 gal
Average Fuel Rate	3.63 gal/hr	Idle Time	N/A
Vehicle Idle Fuel Used	17457.8 gal	Cruise	N/A
Cruise Fuel Used	29872.3 gal	DPF Active Regen Time	N/A
DPF Number of Active Regens	N/A	DPF Used	N/A
Vehicle Speed Limit	78 mph	Cruise Control Speed Limit	78 mph